



## INSTALLATION


The Link Air Drier Kit reduces drain service intervals and improves system reliability by removing moisture and contamination from the compressed air supply.

1. Release all air pressure from the air tank.
2. Assemble the (2) Air Fittings to the “IN” and “OUT” ports and Pressure Switch to the Pilot Port on the Air Drier.
3. Mount the Air Drier in the upright position directly to the frame or use the included mounting bracket to mount the drier to the frame.

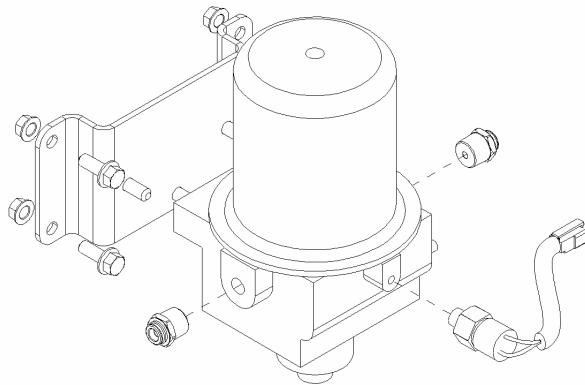


4. Remove the cover from the Air Kit and remove the components as shown below.
5. Reassemble the removed air fitting into the manifold as shown.
6. Cut the drill template as shown on page 4, align the cut edges with the corresponding sides of the Air Kit Housing and tape it to the air kit housing. Center punch the (3) holes, remove the template, and drill the (2)  $\text{\O}0.66$  holes and the  $\text{\O}0.78$  hole. Insert the rubber grommets into the drilled holes.

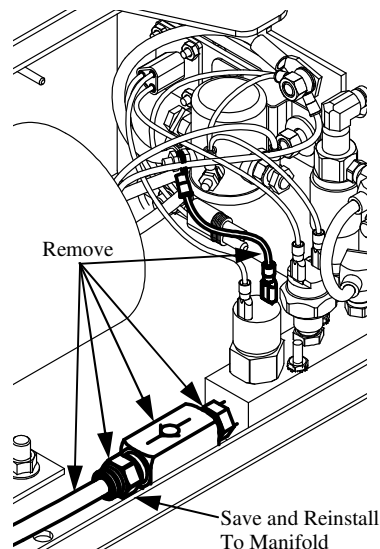

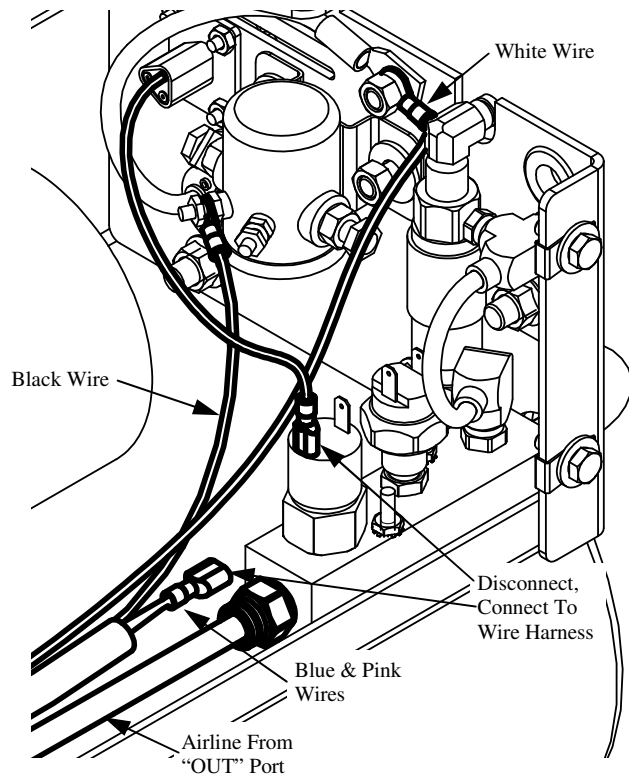




7. Cut supplied air line to required lengths. Connect from the compressor to the "IN" port of the Drier. Connect the other airline from the "OUT" port to the reassembled fitting as shown.
8. Route supplied Wire Harness as shown. Connect the (2) deutsch plugs with the (2) plugs on the Air Drier.
9. Disconnect the wire shown and connect with the blue and pink wire connector on the wire harness.
10. Connect the Black Wire to the relay terminal as shown.
11. Connect the White Wire to the ground post as shown.
12. Reinstall the Air Kit Housing Cover.

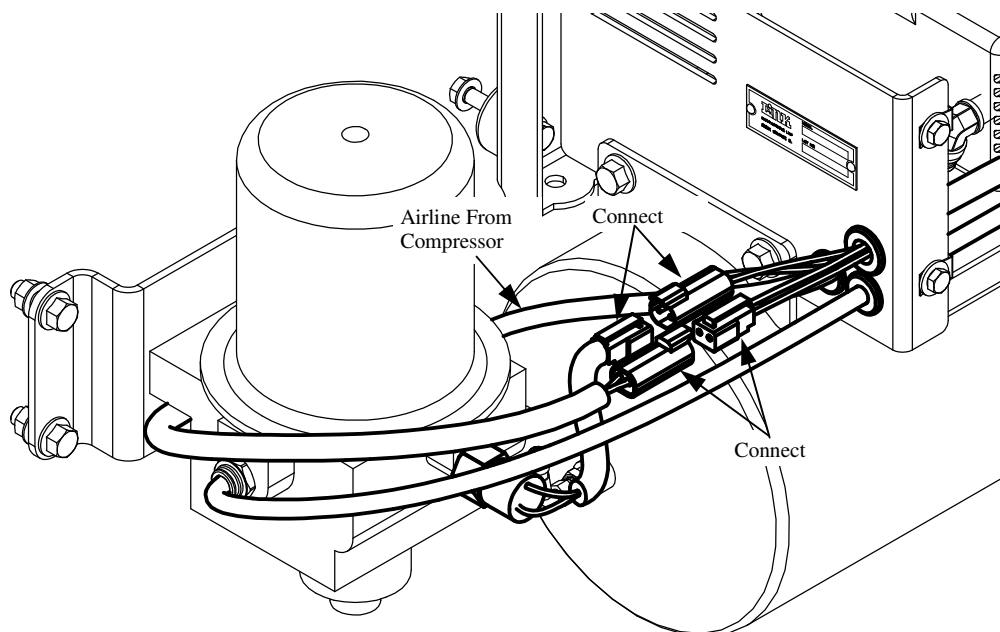

# ***UltraRide*** – Air Drier Update Kit

ITEM	PART NO.	DESCRIPTION	QTY
1	13010573	DRIER-AIR, WITH GOVONOR	1
2	13010575	SWITCH-PRESSURE, 60/120	1
3	13025056	CONNECTOR-MALE, 3/8 TB, 1/2 NPT	2
4	1303-4000	AIRLINE-NYLON, .375 O.D.	7 FT
5	14071005	HEX CAP SCR, M10 X 1.25 X 25, CLASS 8.8	3
6	141A-1208	3/8 X 1 UNC FLANGE BOLT (GRADE 8) O&P	4
7	1480-1204	3/8 UNC TOP LOCK FL NUT (GR G) O&P	4
8	1500-0308	GROMMET-RUBBER, 3/8	2
9	15000312	GROMMET-RUBBER, 1/2	1
10	15051874	HARNESS-AIR DRIER, ULTRARIDE	1
11	15051873	7 AMP FUSE	1
12	80002145	BRACKET-MOUNT, DRIER	1

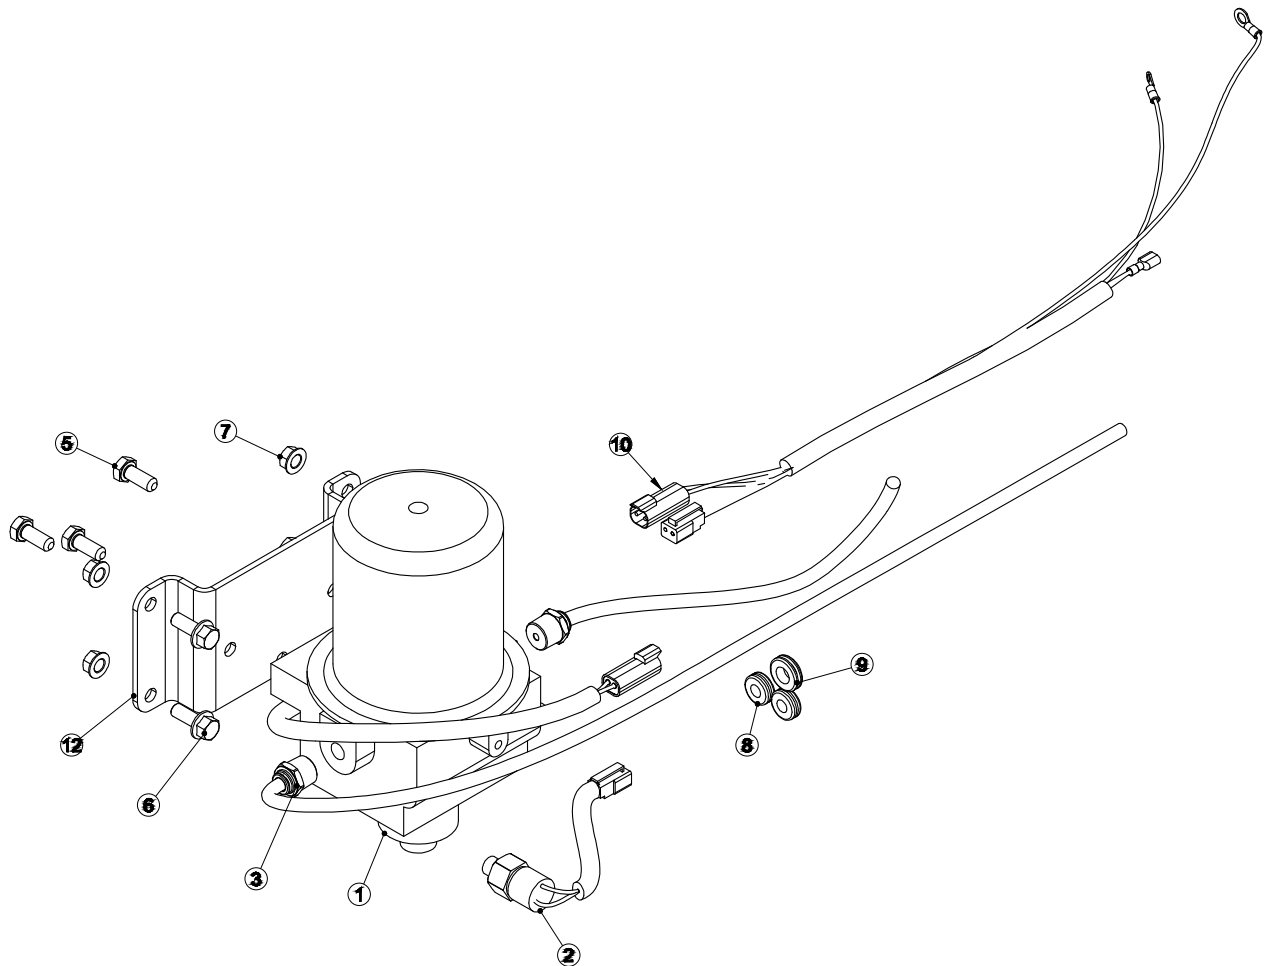

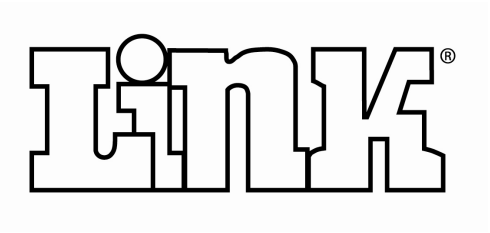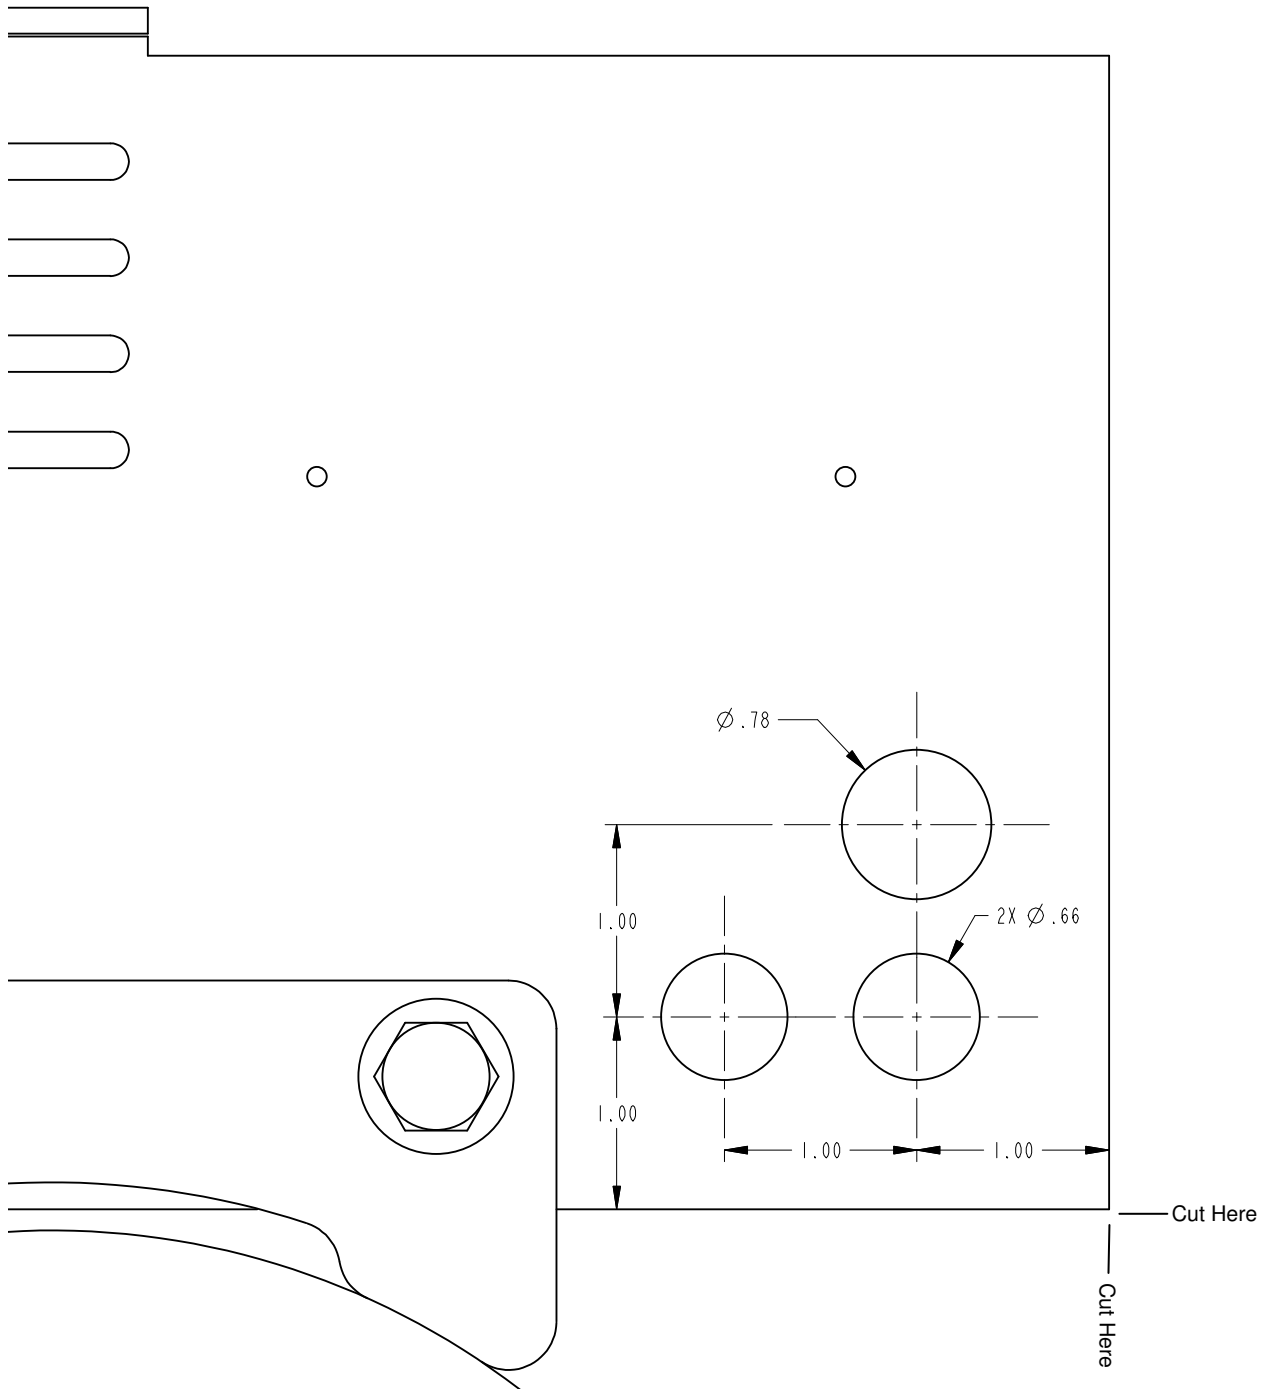

Link Mfg. Ltd.  
 223 15th St. NE  
 Sioux Center, IA USA  
 51250-2120  
 (712) 722-4874  
<http://www.linkmfg.com/>